CST Series Cable Preparation Tools

Warning! This tool should not be used on live electrical circuits. It is not protected against electrical shock! Always use OSHA/ANSI or other industry approved eye protection when using tools. This tool is not to be used for purposes other than intended. Read carefully and understand instructions before using this tool.



The CST series tools are specially designed cable preparation tools for LMR coax cable. These tools will trim the cable to proper conductor and braid exposure lengths for the assembly of applicable clamp, crimp, right angle, and straight connectors.

Set up:


The tool is built with an adjustable stop on the Cut #2 end to give the correct braid exposure length. Refer to chart below. Set the thumb screw in the proper location for proper trim length. Ensure that the cutter block is in the up position on the Cut #1 end. See product picture above.


- 1. Ensure cable end is cut off as square as possible for accurate prep lengths. Insert Operation: cable in Cut #1 end up to stop. (If cable is deformed, some re-forming of the end may be necessary.) Rotate the tool and simultaneously engage the cutter blade by applying thumb pressure to the cutter block. Turn and squeeze until the block bottoms against the tool body. (Fig.1)
- 2. Pull the cable straight out of the tool opening while holding thumb pressure on the cutter block. The exposed conductor length will be developed (Fig.2). Retract the cutter block by pushing up on the guide rod underneath. Ensure the cable chip gets ejected from the tool. If not, re-insert prepared cable end to dislodge stuck cable chip.


Alternative method applicable to larger cables:

Perform step 1 above. Retract the cutter block. Remove the cable and chip together from the tool. Twist the chip off the cable with pliers. (Fig.2a)


- 3. Insert cable into Cut #2 end. With gentle pressure, turn tool in a CW direction to engage jacket blade. Turn tool until cable reaches strip stop and continue turning until jacket chip breaks off. (Fig.3)
- 4. Deburr conductor end with deburring bit on the #2 end of tool (CST400, 500 and 600 models only). Apply forward pressure and rotate back and forth to break sharp edge. Cable end is depicted in Fig.4

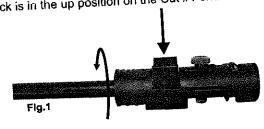

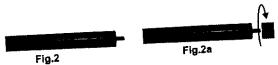

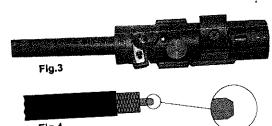



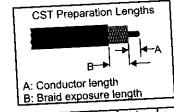

Tool	Body Color	Knob Color	A (Inches)	B (inches)	
				.400	Straight
CST 195/200	Yellow	Red	.15	.650	Right Angle
				.400	Straight
CST 240A*	Green	Gray	.20	,600	Right Angle
CS1 240A	0,00			.500	Straight
CST 300	Red	Red	.25	.750	Right Angle
			 	.349	Clamp
CST 400**	Blue	Gray	.236	.590	Crimp
				.349	Clamp
CST 400-75**	Blue	Black	.236	.590	Crimp
				.330	Clamp
CST 500	Orange	Red	.25	.575	Crlmp
				.375	Clamp
CST 600	Black	Red	.25	750	Crimp

Replaces CST 240 and is now identified by a gray stop kach and new preparation lengths.

Blade Replacement:

To replace the cutter blade, remove the set screw on top of the cutter block. Lift the cutter block from the tool. Do not remove the guide rod mechanism from the tool. On most of the tool models, the top edge of the cutter blade abuts two locating bosses on the block for proper positioning shown at right. The CST 400 cutter block has a full edge to locate the top of the blade.

Use the included hex wrench to remove and replace

When replacing the jacket blade, assemble it fully back in the tool body slot.



CST 400

Replacement Blades: RB-CST-LMR p/n 3192-086

(includes 5 ea First Cut cutter blades, 1 Jacket blade, and blade hardware.)

